



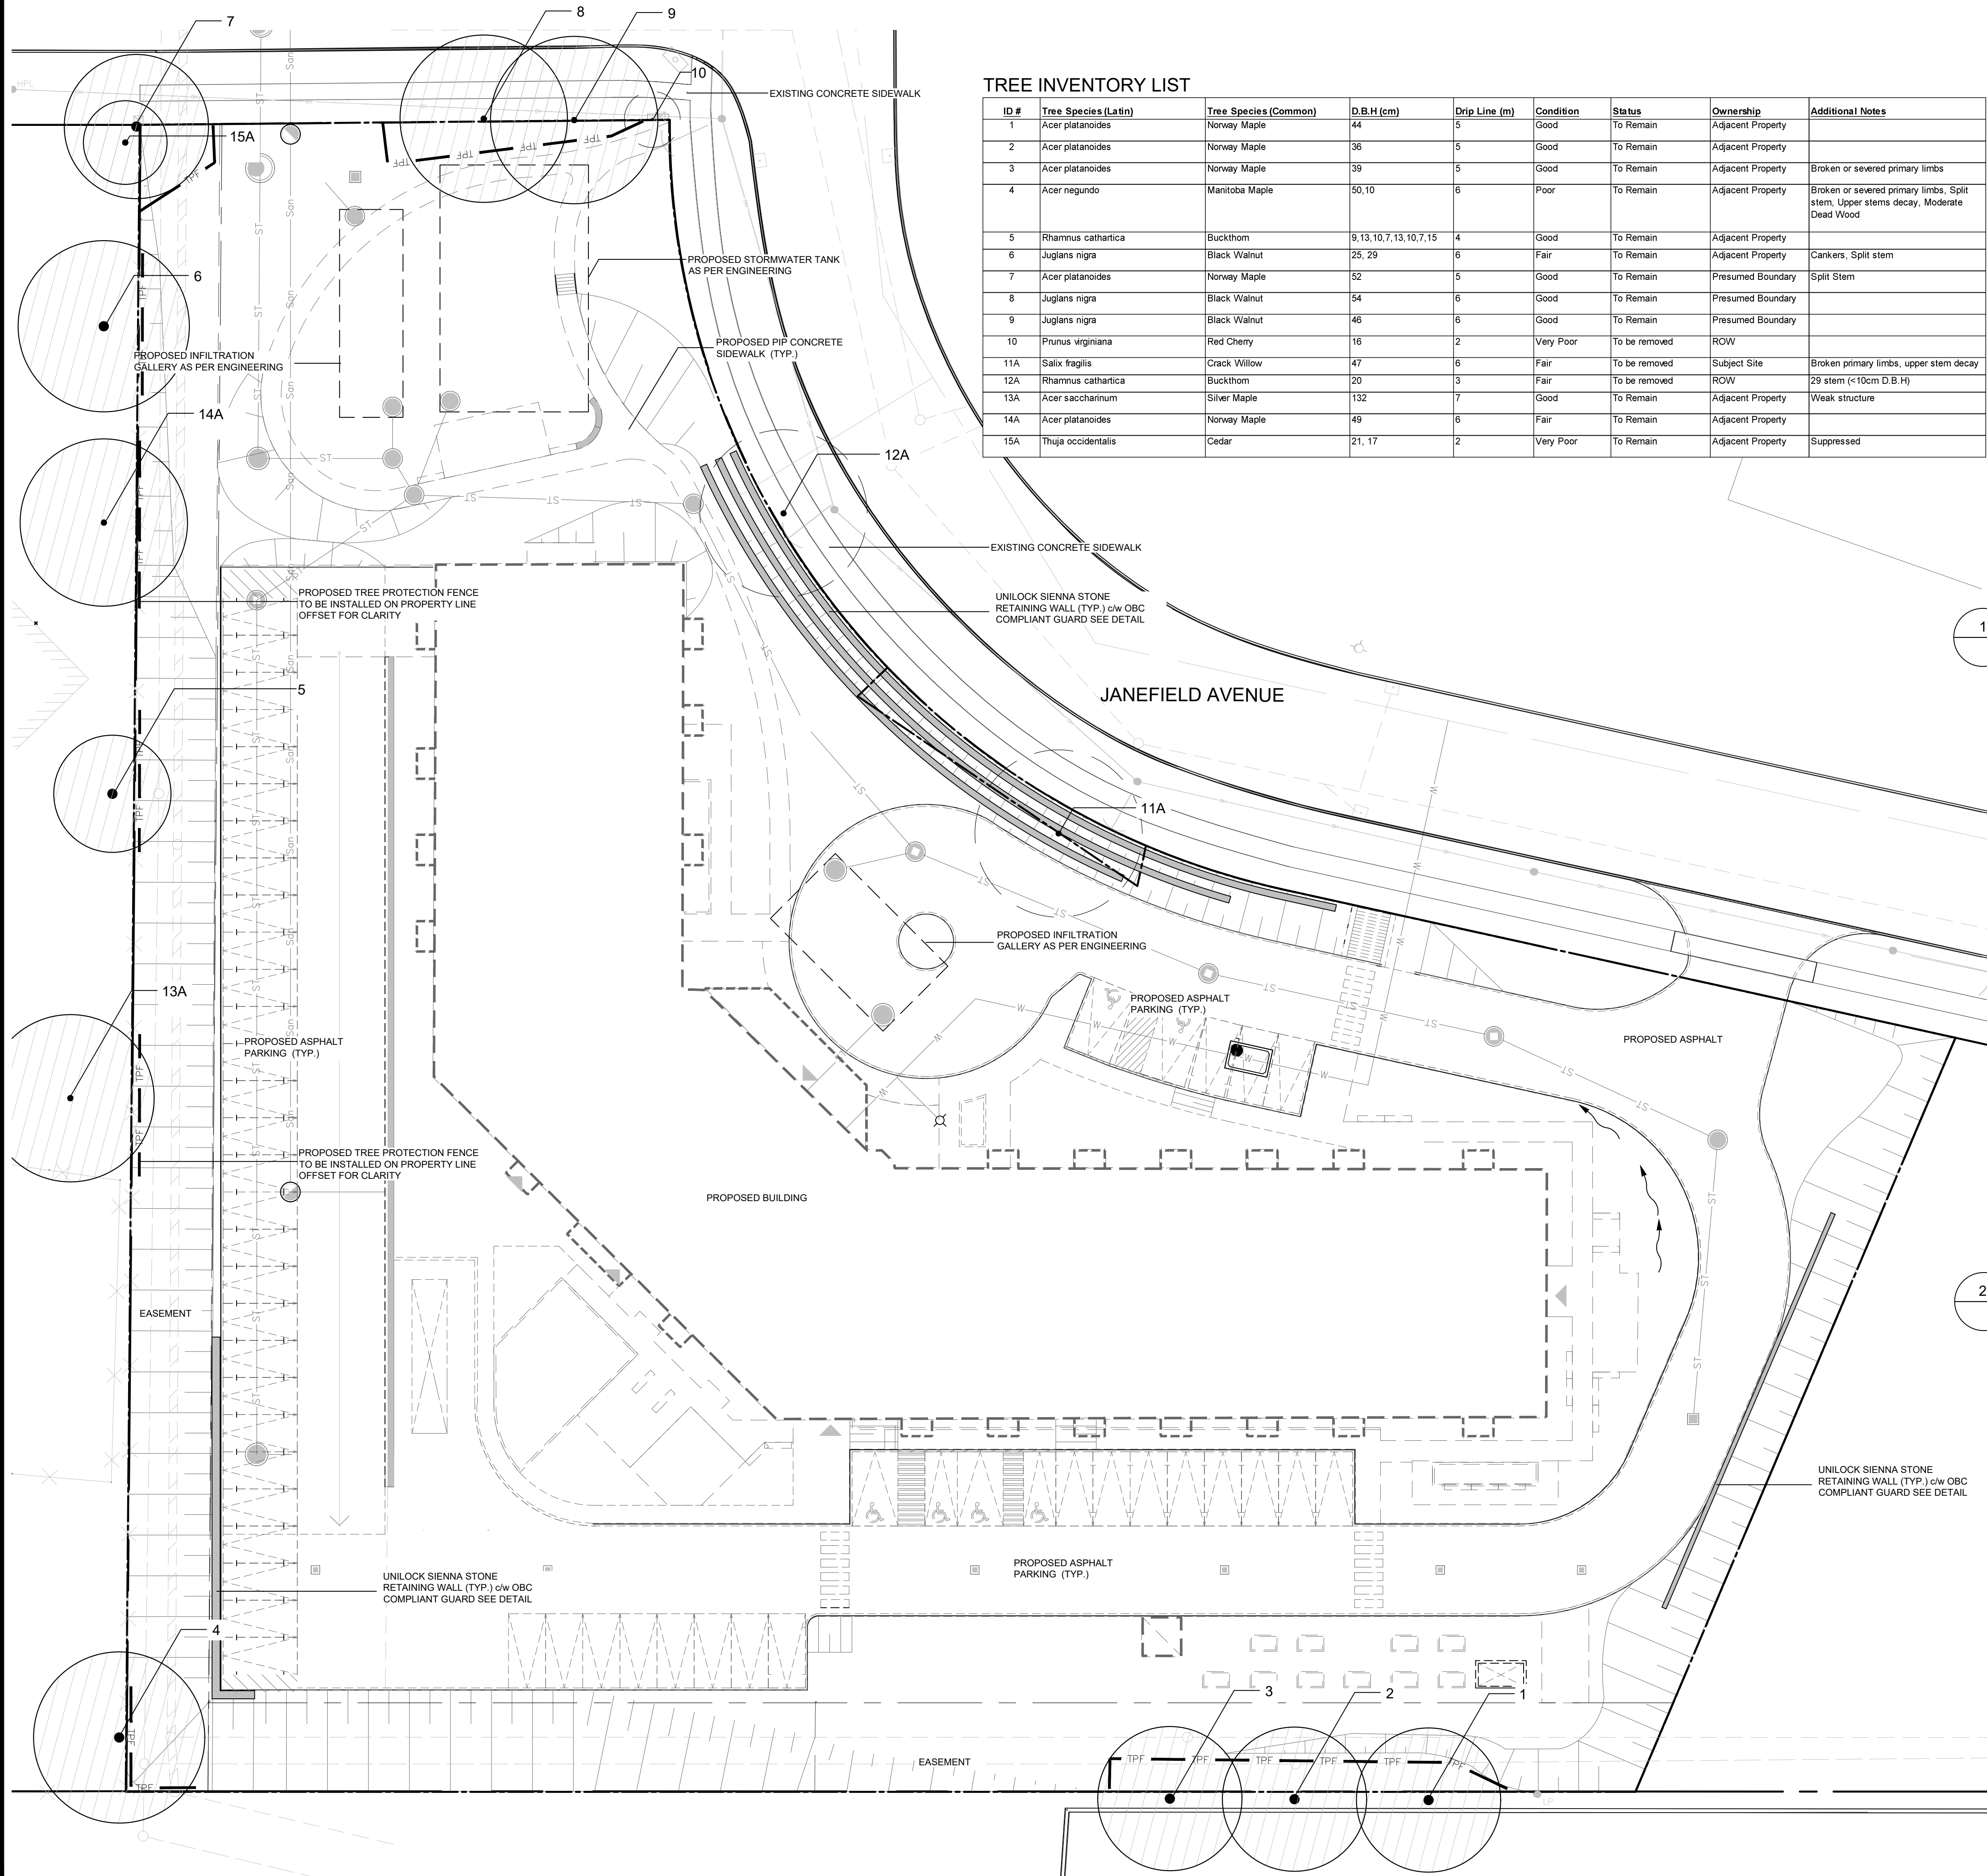


TREE INVENTORY LIST

ID #	Tree Species (Latin)	Tree Species (Common)	D.B.H. (cm)	Drip Line (m)	Condition	Status	Ownership	Additional Notes
1	Acer platanoides	Norway Maple	44	5	Good	To Remain	Adjacent Property	
2	Acer platanoides	Norway Maple	36	5	Good	To Remain	Adjacent Property	
3	Acer platanoides	Norway Maple	39	5	Good	To Remain	Adjacent Property	Broken or severed primary limbs
4	Acer negundo	Manitoba Maple	50, 10	6	Poor	To Remain	Adjacent Property	Broken or severed primary limbs, Split stem, Upper stems decay, Moderate Dead Wood
5	Rhamnus cathartica	Buckthorn	9, 13, 10, 7, 13, 10, 7, 15	4	Good	To Remain	Adjacent Property	
6	Juglans nigra	Black Walnut	25, 29	6	Fair	To Remain	Adjacent Property	Cankers, Split stem
7	Acer platanoides	Norway Maple	52	5	Good	To Remain	Presumed Boundary	Split Stem
8	Juglans nigra	Black Walnut	54	6	Good	To Remain	Presumed Boundary	
9	Juglans nigra	Black Walnut	46	6	Good	To Remain	Presumed Boundary	
10	Prunus virginiana	Red Cherry	16	2	Very Poor	To be removed	ROW	
11A	Salix fragilis	Crack Willow	47	6	Fair	To be removed	Subject Site	Broken primary limbs, upper stem decay
12A	Rhamnus cathartica	Buckthorn	20	3	Fair	To be removed	ROW	29 stem (<10cm D.B.H.)
13A	Acer saccharinum	Silver Maple	132	7	Good	To Remain	Adjacent Property	Weak structure
14A	Acer platanoides	Norway Maple	49	6	Fair	To Remain	Adjacent Property	
15A	Thuja occidentalis	Cedar	21, 17	2	Very Poor	To Remain	Adjacent Property	Suppressed

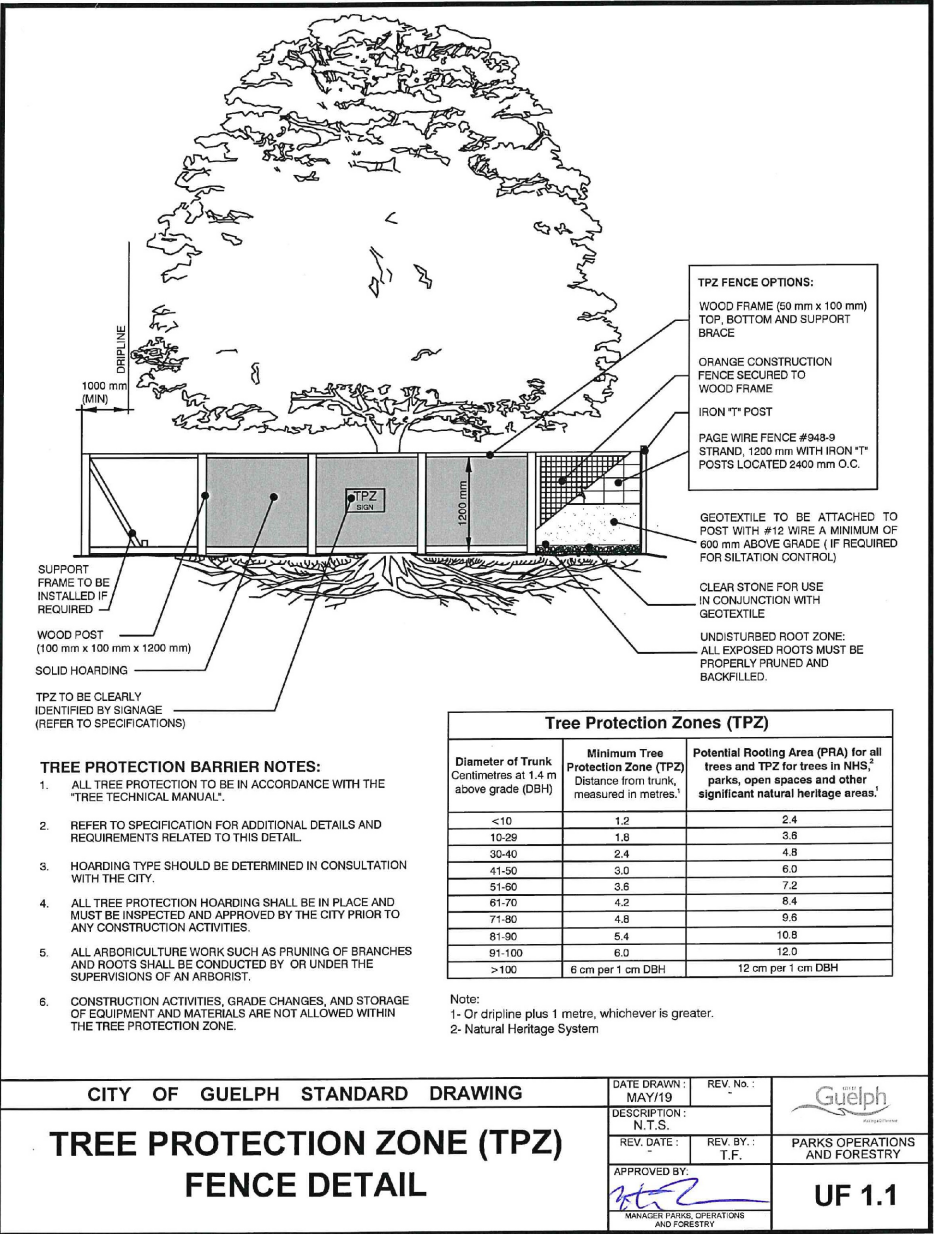


CITY OF GUELPH STANDARD TREE PROTECTION ZONE FENCE DETAIL
 NTS

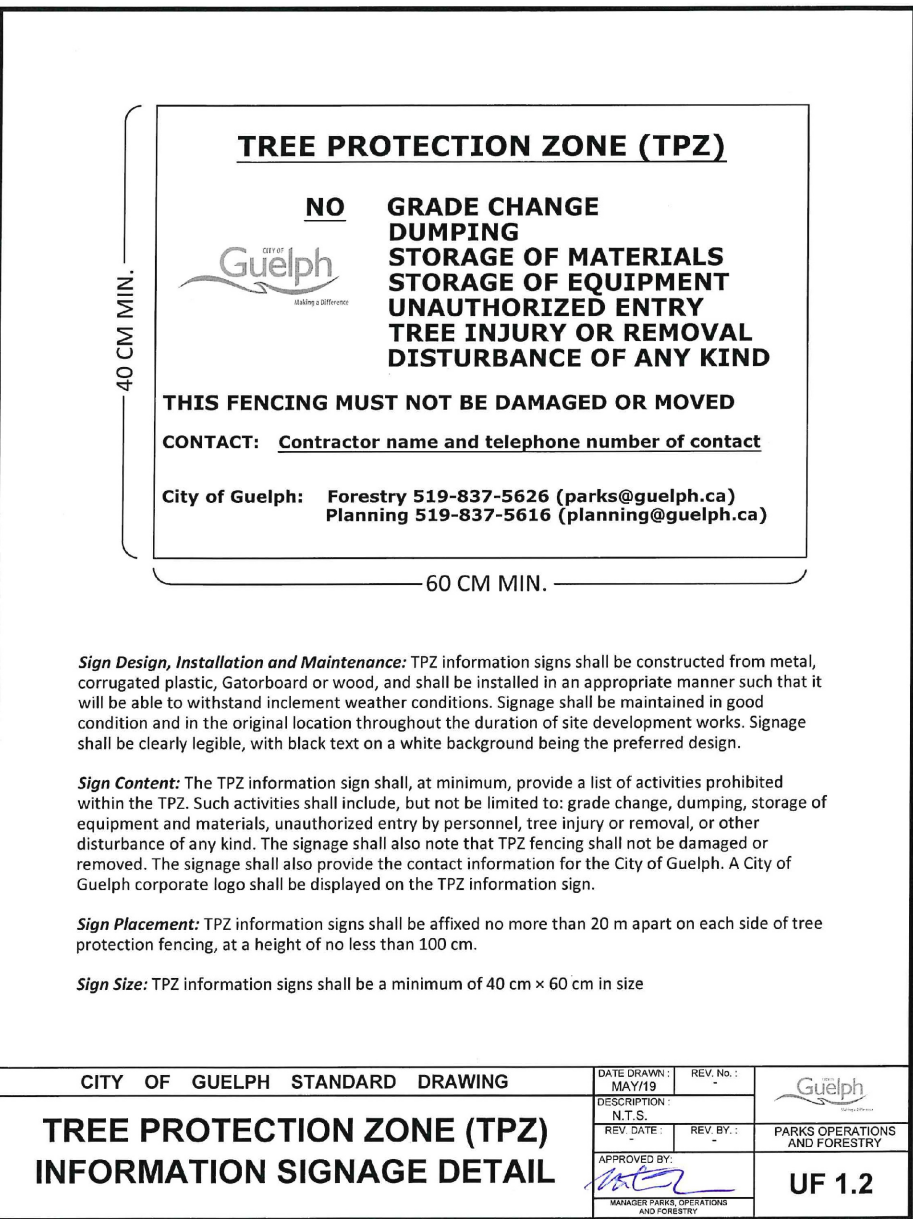

CITY OF GUELPH STANDARD TREE PROTECTION SIGNAGE DETAIL
 NTS

LEGEND

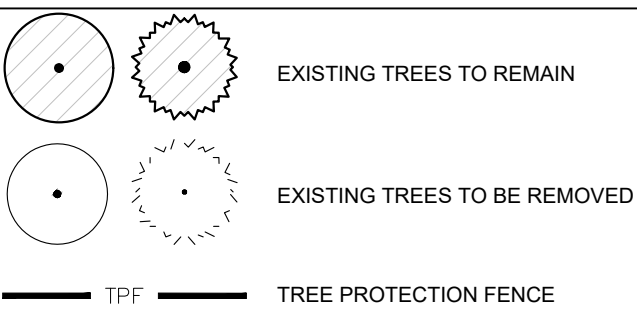


NOTES:

- A SIGNED LETTER OF UNDERSTANDING IS TO BE PROVIDED BY ADJACENT PROPERTY OWNER WHOSE TREES WILL BE IMPACTED BY THE PROPOSED CONSTRUCTION ON THE SUBJECT SITE.
- REMOVAL OF BOUNDARY TREES AND TREES UNDER ADJACENT OWNERSHIP REQUIRES WRITTEN AGREEMENT WITH ADJACENT OWNER.


COMPENSATION:

AS PER CITY OF GUELPH TREE TECHNICAL MANUAL, SECTION 5: COMPENSATION (REPLACEMENT TREES) THE RATIO METHOD IS USED TO CALCULATE TREE COMPENSATION REQUIREMENT.
 (TREES THAT ARE POOR OR VERY POOR AND THE SPECIES Rhamnus cathartica (BUCKTHORN) ARE EXCLUDED FROM THE CALCULATION)
 RATIO METHOD:
 REQUIRED NUMBER OF REPLACEMENT TREES =
 TOTAL D.B.H.(cm) OF EXISTING TREES TO BE REMOVED / 15cm
 TOTAL D.B.H.(cm) EXISTING TREES TO BE REMOVED ON SUBJECT SITE = 63 cm
 TOTAL REQUIRED REPLACEMENT TREES = 5 TREES

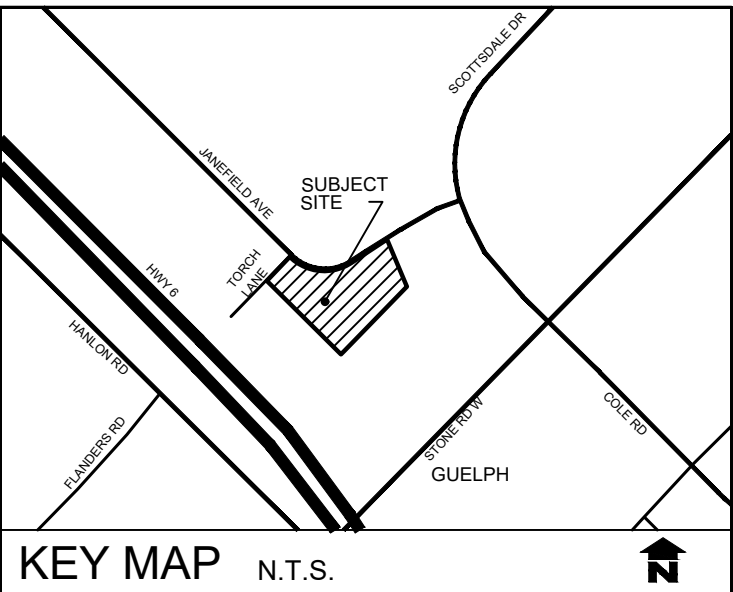

GENERAL NOTES

- SITE VISIT DATE: MAY 22, 2026.
- TREE INVENTORY COMPLETED BY ISA CERTIFIED ARBORIST AARON HILL #ON-3086A.
- TREE LOCATIONS BASED ON VAN HARTEN SURVEYING INC. AND HILL DESIGN STUDIO SITE VISIT ON MAY 22, 2026.
- ALL TREE REMOVALS MUST TAKE PLACE BETWEEN SEPTEMBER 1 AND APRIL 1. AVOID DISTURBING NESTING MIGRATORY BIRDS. TREE REMOVAL MAY BE REMOVED OUTSIDE THIS WINDOW ONLY IF A QUALIFIED BIRD SPECIALIST HAS DETERMINED THESE ARE NO NESTING BIRDS IN THE TREES. THIS REQUIREMENT IS IN ACCORDANCE WITH THE MIGRATORY BIRDS CONVENTIONS ACT, 1994.
- 'A' DENOTES APPROXIMATE LOCATION OF TREE BASED ON HILL DESIGN STUDIO FIELD SURVEY & AERIAL PHOTOGRAPHY.

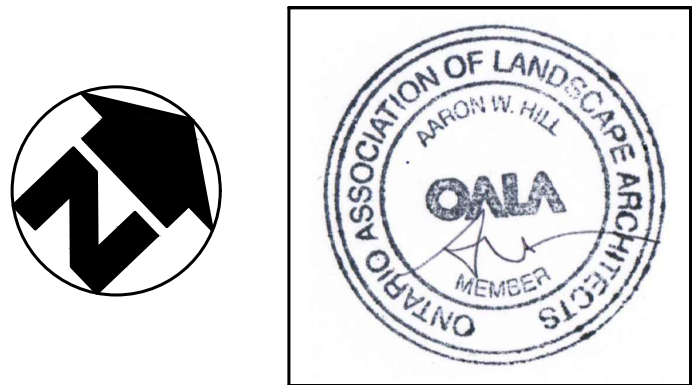

no.	date	description	by
1.	May 22 26	Issued for Approval	EH

Janefield Residence LP
 City of Guelph

Tree Management Plan



PROJECT NO.: 2025-57	DRAWN BY: EH
SCALE: 1:250	DESIGNED BY: EH
SHEET:	APPROVED BY: AWH
L8	PLOT DATE: May 22, 2026